



Reaction to fire test report

Test standard: Ad-hoc test based off ISO 13785-1:2002

Test sponsor: Cladding Safety Victoria (CSV)

System: A cassetted aluminium composite panel wall system

Job number: RTF230111

Test date: 6 September 2023 Revision: R2.0



Quality management

Revision	Date	Information about the report			
R2.0	18 October	Description	Initial issue		
2023			Prepared by	Reviewed by	Authorised by
		Name	Anthony Rosamilia	Mandeep Kamal	Steven Halliday
		Signature		Tekamel:	fll.



Contents

1.	Introducti	on		4
2.	Test specimen			4
2.1	Schedule of	components		4
3.	Test proc	edure		7
4.	Test mea	surements and results		8
5.	Application of test results			
5.1 5.2 5.3	5.2 Variations from the tested specimen			12 12 12
Арре	Appendix A Drawings of test assembly			13
Арре	endix B	Photographs		16
Appe	endix C	Chemical analysis results		32



1. Introduction

This report documents the findings of the second of three ad-hoc reaction to fire tests on a cassetted aluminium composite panel (ACP) external wall system - performed on 6 September 2023. The test was based on ISO 13785-1:2002.

Warringtonfire performed the test at the request of the test sponsor listed in Table 1.

Table 1 Test sponsor details

Test sponsor	Address
Cladding Safety Victoria	717 Bourke Street Docklands VIC 3808
	Australia

2. Test specimen

2.1 Schedule of components

Table 2 describes the test specimen and lists the schedule of components. These were provided by the representatives of the test sponsor and surveyed by Warringtonfire. All measurements were done by Warringtonfire – unless indicated otherwise.

Detailed drawings of the test specimen are provided in Appendix A.

Table 2 Schedule of components

Item	Description		
Cladding			
1.	Item name	ACP Panelling - cassetted	
	Product	Econ Panel TM - 3 mm Glossy White/Matte White (BC-03E) with 0.21 mm skin	
	Manufacturer/Supplier	SAS Signage	
	Material	The material was nominated as panels consisting of two layers of aluminium sheets sandwiching a layer (core) with 45 % polyethylene (PE) with inorganic filler. Analysis conducted by the analytical centre of UNSW showed that the core consisted of polyethylene-vinyl acetate (PEVA) - found to be 49.8 % w/w - whilst the remainder of the material was found to be 40.2 % calcium carbonate, 7.9 % other inert material and 2.1 % magnesium hydroxide.	
		Refer to Appendix C for more detailed results - Sample 23139-3, CSV #4.	
	Size	As shown in Figure 7.	
		Total thickness – 3.1 mm	
		Skin thickness (both sides) – 0.2 mm	
		Cassette depth – 150 mm	
	Measured mass/unit area densities	Panel areal density – 4.8 kg/m ²	
2.	Item name	FR Plasterboard	
	Product	CSR Gyprock 13 mm Fyrchek	
	Manufacturer/Supplier	CSR Gyprock	
	Size	Measured board: 3000 mm × 1200 mm × 13 mm	
	Batch Date:	16/08/22	
	Areal density (measured)	11.0 kg/m ²	
3.	Item name	Backpan	

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230111

Test sponsor: Cladding Safety Victoria (CSV)



Item	Description			
	Product	0.9 mm thick Galvabond steel		
	Supplier	BlueScope		
	Size	Measured: 1160 mm wide × 3700 mm tall, 0.9 mm thick – in segments		
Framii	ng			
4.	Item name	Test rig frame - 90 × 90 SHS and 200 × 90 PFC frame		
	Size	90 mm × 90 mm × 5 mm thick and 200 mm × 90 mm × 10 mm thick – refer to Figure 6.		
5.	Item name	Aluminium curtain wall transom/mullions (rectangular hollow sections) - framing		
	Size	65 mm wide × 120 mm deep × 3 mm thick Total frame size: 120 mm deep × 1165 mm wide × 3705 mm tall		
	Manufacturer/Supplier	Capral Aluminium		
6.	Item name	Aluminium angles - framing		
	Size	20 mm wide x 30 mm deep x 3 mm thick		
	Manufacturer/Supplier	Rapid Aluminium		
7.	Item name	Aluminium stiffener - framing		
	Size	3 mm thick		
	Manufacturer/Supplier	Rapid Aluminium		
8.	Item name	Internal side frame - steel		
	Size	Studs and noggings: 90 mm deep × 36 mm wide × 0.55 BMT		
	Installation	The steel framing members were riveted (item 17) to one another.		
9.	Item name	Strap – 50 mm wide		
	Size	Studs and noggings: 90 mm deep × 36 mm wide		
	Installation	The steel framing members were riveted (item 17) to one another.		
Smoke	e seal			
10.	Item name	Smoke seal		
	Size	1 mm thick galvanised steel		
	Manufacturer/Supplier	Atlas Steel		
Insula	tion			
11.	Item name	90 mm thick polyethylene terephthalate (PET) insulation		
	Density	10 kg/m³		
	Manufacturer/Supplier	Pricewise Insulation		
12.	Item name	50 mm thick aluminium - with fibre-glass mesh - foil faced rockwool insulation		
	Density of core	40 kg/m ³		
	Manufacturer/Supplier	Rockwool Insulation Australia		
Sealar	nt/Adhesive			
13.	Item name	Weathering sealant		
	Product type	Silicone sealant		
	Product name	PROSIL 41Im		
	Manufacturer/Supplier	Admil Adhesives		



Item	Description		
	Usage	Placed at ACP edges and over screw and rivet locations.	
Fixings			
14.	Item name	Wafer head screws – zinc coated steel	
	Size	10g × 16 mm long	
	Installation	Used to fix aluminium angles (item 6) to the aluminium frame (item 5) at 500 mm centres	
15.	Item name	Wafer head screws – zinc coated steel	
	Size	10g × 50 mm long	
	Installation	Used to fix ACP (item 1) to the aluminium stiffener (item 7) – four per corner.	
16.	Item name	Hex head tek screw – zinc coated steel	
	Size	12g × 16 mm long	
	Installation	Used to fix aluminium stiffeners (item 7) to themselves	
17.	Item name	Steel rivets	
	Size	Ø4 mm	
18.	Item name	Plasterboard screws	
	Size	6g x 32 mm long, bugle head, self-drilling screws	
19.	Item name	Fast-fix washers and pin weld	
	Size	115 mm × 3 mm pins and 25 mm × 25 mm fast fix washers.	

Installation method

Internal wall:

The test rig frame (item 4) was the main support for the test specimen, however, there were two C-purlin sections that acted as false slabs (200 mm tall). Steel stud framing (item 8) was installed between the C-purlins. PET insulation (item 11) was inserted within the steel framing (item 8) and was capped with 13 mm thick FR plasterboard (item 2) on the unexposed side and along the edges. The plasterboard was fixed with plasterboard screws (item 18) - max 300 mm centres on the periphery and 600 mm centres in-field.

External wall:

The external section of the wall system largely consisted of an aluminium extrusion framing system (item 5), galvanised steel sheet backpan (item 3) and ACP cassette system (item 1). The external wall was screw fixed using angles. The ACP cassettes were 150 mm deep and were connected to the aluminium extrusion framing (item 5) using aluminium angles (item 6) and aluminium stiffeners (item 7). The angles (item 6) were screw fixed to the extrusions, the aluminium sheeting riveted to the angles, and the ACP cassettes riveted to the aluminium sheets. Sealant (item 13) was used to seal open ACP edges, screw fixings and rivet

The backpan (item 3) was screw fixed and riveted to the back of the aluminium extrusion framing (item 5). Foil faced insulation (item 12) was installed within the external wall. The insulation was held to the steel backpan (item 3) with the aid of fast-fix washers and pin combinations (item 19) - at ~600 mm centres - that were welded to the backpan. There was a 60 mm gap between the backpan and the internal wall studwork.

Revision: R2.0 Test sponsor: Cladding Safety Victoria (CSV) Page 6 of 40



Test procedure 3.

Table 3 details the test procedure for this reaction to fire test.

Table 3 **Test procedure**

Table 5 Test	procedure			
Item	Detail			
Statement of compliance	The ad-hoc test – which was based off ISO 13785-1:2002 - was performed to dete the reaction to fire performance of an external wall cladding when exposed to heat simulated external fire with flames impinging directly upon a façade. The test utilise burner used in ISO 13785-1:2002 with the specimen mimicking the as-is construction the façade.			
Sampling / specimen selection	The laboratory was not involved in sampling or select to fire test. The results obtained during the test only apply to the by Warringtonfire.			
Test duration	Approximately 21 minutes			
Ambient	Start of the test	19 °C		
laboratory temperature	Minimum temperature	19 °C		
·	Maximum temperature	21 °C		
Instrumentation and equipment	 Eight mineral insulated metal sheathed (MIMS) Type K thermocouples with an overall diameter of 1.5 mm with the measuring junction insulated from the sheath were positioned 60 mm in front of the face of the test specimen. Refer to Figure 1 (TC011 – TC018) for details on positioning. Ten mineral insulated metal sheathed (MIMS) Type K thermocouples with an overall diameter of 1.5 mm with the measuring junction insulated from the sheath were positioned inside the specimen at the centre of the cavity. Refer to Figure 1 (TC001 – TC010) for details on positioning. The incident heat flux on the top of the specimen in line with the front face of test specimen was measured using one Schmidt-Boelter type heat flux gauge with a range of 0-50 kW/m². The fire source was a propane (95% purity) gas burner 1.2 m long x 0.1 m deep x 0.15 			
	m tall. The burner was placed on the floor below the specimen with approximately 10 mm overlap with the ACP.			
Test procedure	 At least two minutes of baseline data was collected prior to burner ignition. Temperature and heat flux data was collected at 5 s intervals. The heat output from the burner was held at 200 kW for the duration of the test. The burner was then turned off and the specimen sprayed with water when excessive flaming was observed. 			
Test number	Test two of three.			
Variation between tests				

Revision: R2.0 Page 7 of 40 Test sponsor: Cladding Safety Victoria (CSV)



4. Test measurements and results

The results from the tests are summarised below. Photographs of the specimen are included in Appendix B.

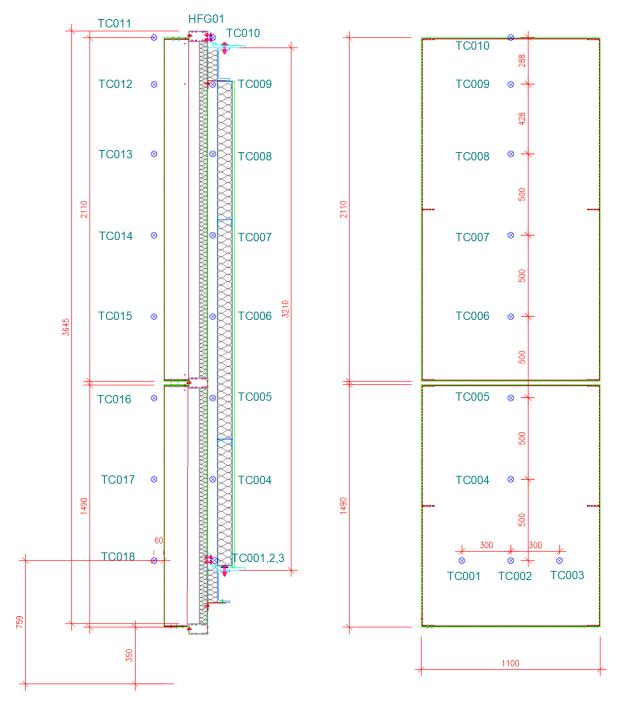


Figure 1 Instrumentation location



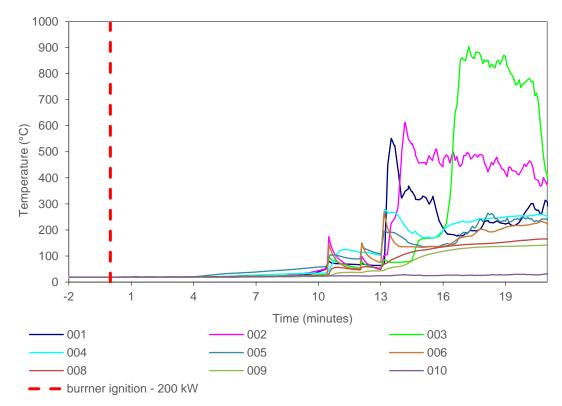


Figure 2 Internal temperature data collected by thermocouples placed within the cavity – between the internal and external segments of the specimen.

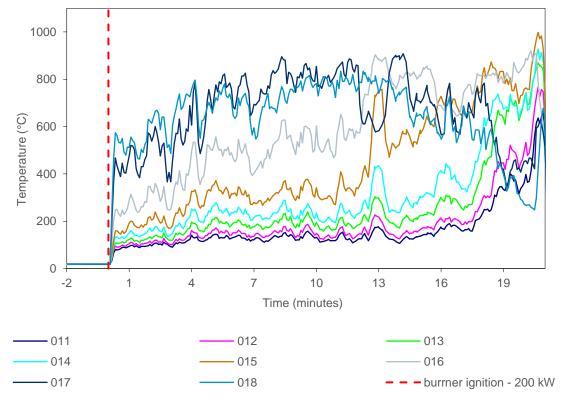


Figure 3 External temperature data collected by thermocouples placed 60 mm from the front face of the specimen.



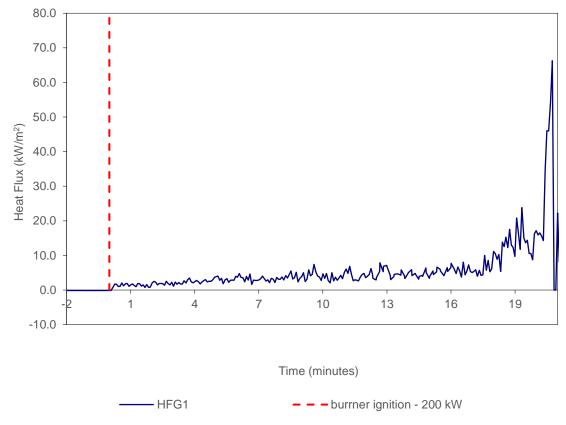


Figure 4 Heat flux data collected by heat flux gauges.

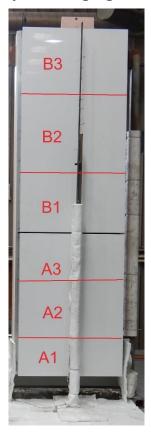


Figure 5 Designation for test specimen observations.



Table 4 shows the observations of any significant behaviour of the specimen during the test.

Video recordings were also taken of the test. A copy of the video recording is available upon request from the test sponsor or by contacting Cladding Safety Victoria. The video of the test should be viewed in conjunction the contents of this report.

Table 4 Test observations

. 3.0.0			
		Section	Observation
Min	Sec		
-2	00	AII	Data collection started.
0	00	All	The reaction to fire test was started with the burner ignited with a heat output set at 200 kW.
0	14	A1/A2	There was discolouration on the front face of the panel.
2	12	А3	There was discolouration on the front face of the panel.
2	26	A3/B1	Flaming had reached the joint between A3/B1.
2	44	B1	The flames reached B1.
2	56	A1	There was flaming dripping debris from the bottom of the specimen.
3	55	All of A	The specimen released a puff of flames.
5	11	B1	There was discolouration on the front face of the panel.
7	02	All of A	The panel has started to deform.
7	39	B1	The section of the panel has started to deform.
8	02	B2/B3	Flames have gone up the sides of the specimen.
9	15	B2	The section of the panel has started to deform.
9	23	All	A popping sound was heard.
10	23	All	A puff of flames was released on the back face.
11	34	В	Sealant has melted of the sides of the specimen.
11	55	All	A puff of flames was released on both sides.
12	55	All	A puff of flames was released on both sides.
13	20	A2/A3	There is a hole in the front face of the panel with flames coming out.
14	10	All of B	Both sides of the panel started to deform.
16	16	B1	Flames are travelling up the left side of the specimen
17	00	B1	It appears the panel face has opened up and the panel core is contributing to the flaming. Flames travelling up the centre.
18	12	B2	It appears the panel face has opened up further and the panel core is contributing to the flaming. Flames travelling up the centre.
18	22	B2	Flames are travelling up the left side of the specimen
19	10	B3	It appears the panel face has opened up further and the panel core is contributing to the flaming. Flames travelling up the centre.
20	02	В3	Flames from the specimen has reached the top of the specimen.
20	51	All	Flaming of the specimen was excessive. The power to the burner was cut and specimen was sprayed with water. The test ended.



5. Application of test results

5.1 Test limitations

The results of these fire tests may be used to directly assess fire hazard, but it should be recognised that a single test method will not provide a full assessment of fire hazard under all fire conditions.

These results only relate to the behaviour of the specimen of the element of construction under the particular conditions of the test. They are not intended to be the sole criteria for assessing the potential fire performance of the element in use, and they do not necessarily reflect the actual behaviour in fires.

5.2 Variations from the tested specimen

This report details methods of construction, the test conditions and the results obtained when the specific element of construction described here was tested following the procedure outlined in Table 3. Any significant variation with respect to size, construction details, loads, stresses, edge or end conditions is not addressed by this report.

It is recommended that any proposed variation to the tested configuration should be referred to the test sponsor. They should then obtain appropriate documentary evidence of compliance from Warringtonfire or another accredited testing authority.

5.3 Uncertainty of measurements

Because of the nature of reaction to fire testing and the consequent difficulty in quantifying the uncertainty of measurements obtained from a reaction to fire test, it is not possible to provide a stated degree of accuracy of result.



Appendix A Drawings of test assembly

The drawings of the test assembly in Figure 6 to Figure 9 were provided representatives of Warringtonfire. Dimensions, unless specified, are in mm.

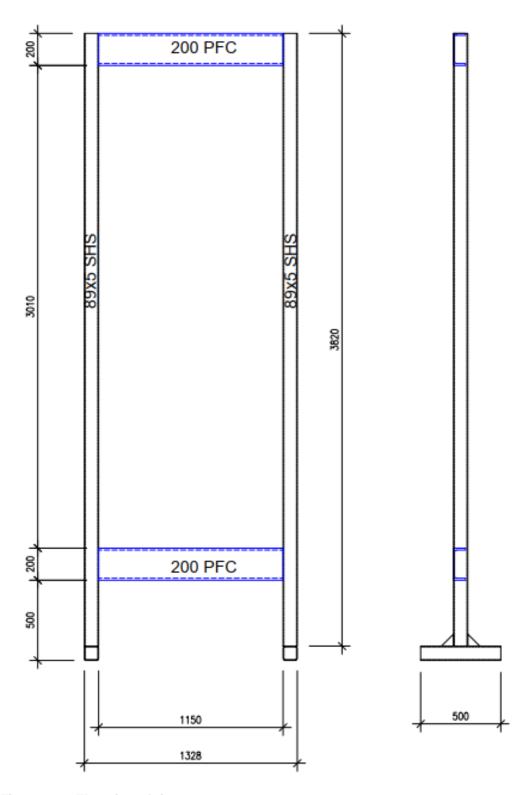


Figure 6 Elevation of rig support.

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230111

Test sponsor: Cladding Safety Victoria (CSV)



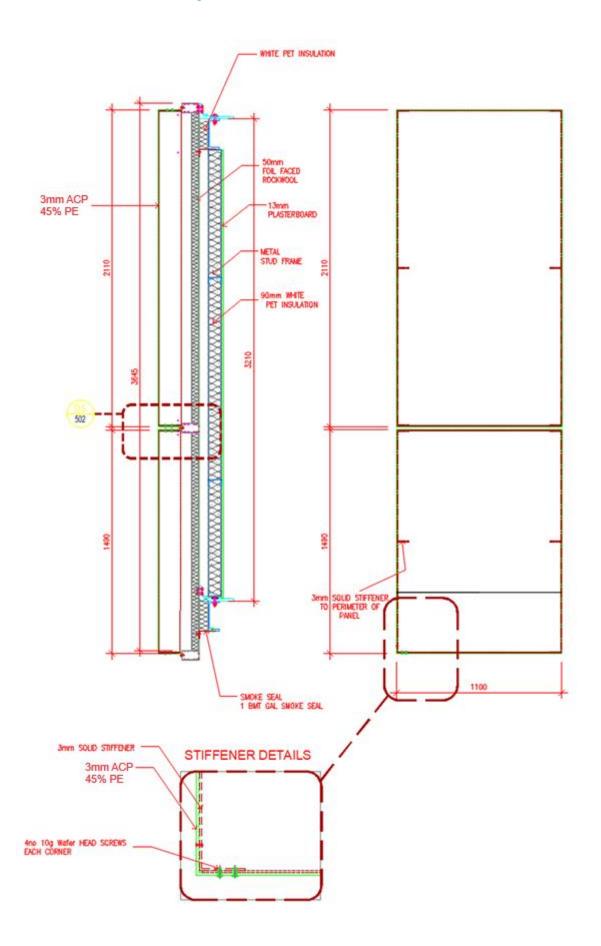




Figure 7 System assembly – Front and side view

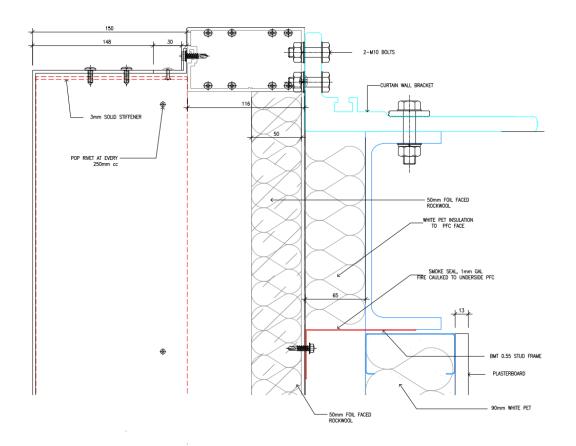


Figure 8 System assembly – top edge detail

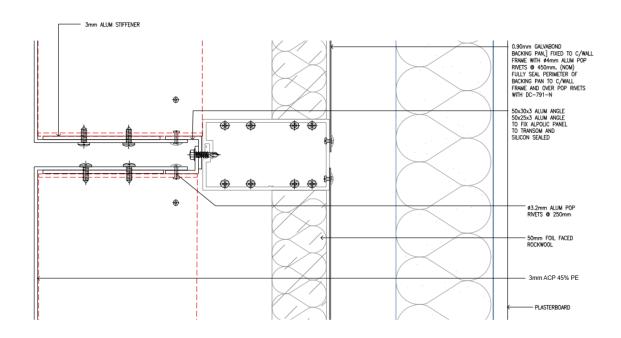


Figure 9 System assembly – middle join detail (D05)



Appendix B Photographs



Figure 10 The specimen before the reaction to fire test





Figure 11 The specimen before the reaction to fire test – unexposed side



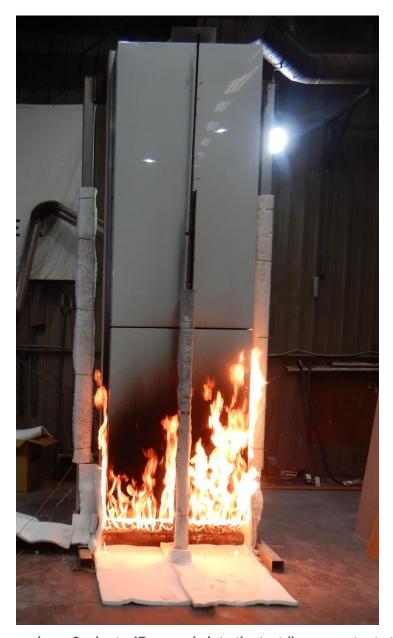


Figure 12 The specimen 2 minute 47 seconds into the test (burner output at 200 kW)



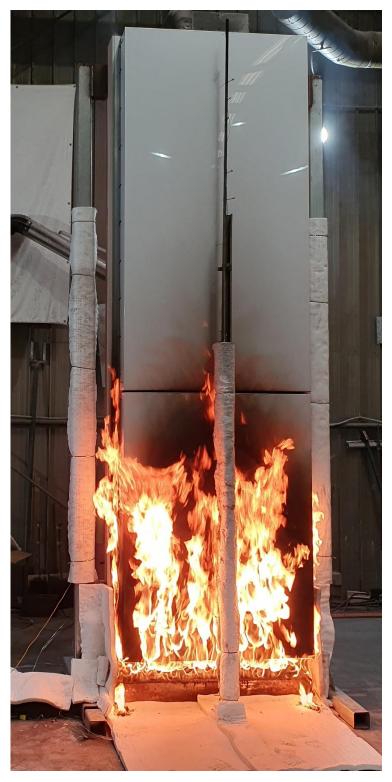


Figure 13 The specimen 6 minutes 7 seconds into the test (burner output at 200 kW)





Figure 14 The specimen 9 minutes 20 seconds into the test (burner output at 200 kW)





Figure 15 The specimen 10 minutes into the test (burner output at 200 kW)





Figure 16 The specimen 13 minutes into the test (burner output at 200 kW)





Figure 17 The specimen 15 minutes into the test (burner output at 200 kW)





Figure 18 The specimen 17 minutes 30 seconds into the test (burner output at 200 kW)





Figure 19 The specimen 19 minutes into the test (burner output at 200 kW)





Figure 20 The specimen 20 minutes into the test (burner output at 200 kW)





Figure 21 The specimen 20 minutes 33 seconds into the test (burner output at 200 kW)





Figure 22 The specimen 20 minutes 47 seconds into the test (burner output at 200 kW)





Figure 23 The specimen 20 minutes 51 seconds into the test (burner output at 200 kW) – at test termination.





Figure 24 The specimen after the test.





Figure 25 The specimen after the test – unexposed side.



Appendix C Chemical analysis results



UNSW RESEARCH INFRASTRUCTURE

Chemical Consulting Laboratory

Mark Wainwright Analytical Centre UNSW Sydney NSW 2052 Australia

T: +61(2) 9348 1400 | E: <u>col@unsw.edu.au</u>
W: <u>www.analytical.unsw.edu.au/contact-us/commercial-consulting</u>
ABN 57 195 873 179 | CRICOS Provider Code 00098G

Test Report

Prepared by:

ANALYSIS OF CLADDING SAMPLES

REF: CSV Sample Collection

For

Nevermind Facades Ptv Ltd Company:

Contact: Mila Kamber Date: 22 August 2023

Project No: 23139

Prepared by: Afsaneh Khansari Approved by: Dominic D'Adam

00 000

000

COMMERCIAL-IN-CONFIDENCE

Any use of the Test Report, use of any part of it, use of the names University of New South Wales or UNSW, use of the name of any Unit of UNSW, or use of the name of the consultant in direct or indirect advertising or publicity is strictly forbidden.

Project No.: 23139

Chemical Consulting Laboratory - UNSW

Page 1 of 10

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230111

Test sponsor: Cladding Safety Victoria (CSV)

Revision: R2.0 Page 32 of 40





Analysis of Cladding Samples, CSV Sample Collection

1. SAMPLES

One box containing five ACP cores was received for analysis. The samples were identified as follows:

CCL sample coding	Client sample coding
23139-1	CSV #02
23139-2	CSV #03
23139-3	CSV #04
23139-4	CSV #08
23139-5	CSV #09

CCL has been asked to identify the polymer and the filler (s) in the sample by FT/IR, quantitate and identify the mineral filler in the sample and classify them in accordance with the ICA cladding scheme.

2. METHODOLOGY AND RESULTS

The aluminium metals were removed from the ACPs cladding polymers, and the flat surface of the polymer samples was abraded to remove any surface adhesive. The surface of each sample was analysed directly by FTIR. The FT-IR spectra are presented in Figures 1-5.

The core of each sample was then ashed to determine its percentage mineral content (Table 1). If sufficient (>0.5 g) ash had been produced it would have been analysed for elemental composition by X ray fluorescence spectroscopy. Results are presented in Table 2.

Table 1 Ash content of 23139-1 to 23139-5

Sample coding	Ash content (w/w%)
23139-1	19.1
23139-2	21.9
23139-3	31.9
23139-4	38.3
23139-5	18.9

Project No.: 23139 **Chemical Consulting Laboratory - UNSW** Page 2 of 10

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230111

Revision: R2.0 Test sponsor: Cladding Safety Victoria (CSV) Page 33 of 40



Table 2 Elemental composition of 23139-3 (CSV-04) and 23139-4 (CSV-08)

Element Oxide wt.%	23139-3	23139-4
Na₂O	0.46	0.50
MgO	4.59	6.80
Al ₂ O ₃	1.08	0.96
SiO ₂	7.09	6.63
P ₂ O ₅	0.06	0.07
SO₃	1.43	2.71
K ₂ O	0.17	0.16
CaO	70.53	59.61
TiO ₂	1.17	1.80
V ₂ O ₅	<0.01	0.01
Cr ₂ O ₃	<0.01	<0.01
Mn ₃ O ₄	<0.01	<0.01
Fe ₂ O ₃	0.90	0.90
NiO	<0.01	<0.01
CuO	0.14	0.10
ZnO	2.48	2.47
Sr0	0.10	0.17
ZrO ₂	<0.01	<0.01
BaO	3.02	6.15
HfO ₂	<0.01	<0.01
PbO	<0.01	<0.01
L.O.I.	ND	ND

NOTE: (i) L.O.I.= loss on ignition at 1,050 °C.

(ii) ND = not determined



Project No.: 23139 Chemical Consulting Laboratory - UNSW

Page 3 of 10

This report shall not be reproduced, except in full, without written approval of the CCL



2. CONCLUSIONS

The cladding CSV #02 consisted of 80.9% poly(ethylene-vinyl acetate) (PEVA) polymer and 19.1% other

The cladding sample #1, CSV #02 is classified as ICA category A.

The cladding CSV #03 consisted of 78.1% poly(ethylene-vinyl acetate) (PEVA) polymer and 21.9% other inert material.

The cladding sample #2, CSV #03 is classified as ICA category A.

The cladding CSV #04 consisted of 2.1% magnesium hydroxide, 40.2% calcium carbonate, 7.9% other inert material and approximately 49.8% poly(ethylene-vinyl acetate) (PEVA) polymer.

The cladding sample 3, CSV #04 is classified as ICA category A.

The cladding CSV #08 consisted of 3.8% magnesium hydroxide, 40.7% calcium carbonate, 12.9% other inert material and approximately 42.6% poly(ethylene-vinyl acetate) (PEVA) polymer.

The cladding sample 4, CSV #08 is classified as ICA category A.

The cladding CSV #09 consisted of 81.1% poly(ethylene-vinyl acetate) (PEVA) polymer and 18.9% other inert material.

The cladding sample 5, CSV #09 is classified as ICA category A.

The ICA Classification assigned is correct as per the September 2020 revision of the ICA Guidelines.

The calculation for magnesium hydroxide content assumes that all magnesium found is present as the hydroxide. The calculation for calcium carbonate content assumes that all calcium found is present as calcium carbonate.

The reader is reminded that we can only analyse and classify the content of samples actually presented to us. We can offer no guarantee that this composition or classification is valid for cladding as a whole, because some types of cladding can be inhomogeneous, and a sample may not be representative of the cladding as a whole. Anyone using our results should consider these sampling issues and uncertainties before they generalise the results we present to anybody of cladding as a whole.



Project No.: 23139 **Chemical Consulting Laboratory - UNSW**

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230111

Revision: R2.0 Test sponsor: Cladding Safety Victoria (CSV) Page 35 of 40




Afsaneh Khansari (PhD)
Technical Officer
Chemical Consulting Laboratory
Mark Wainwright Analytical Centre, UNSW
22 August 2023




Project No.: 23139 Chemical Consulting Laboratory - UNSW Page 5 of 10

This report shall not be reproduced, except in full, without written approval of the CCL



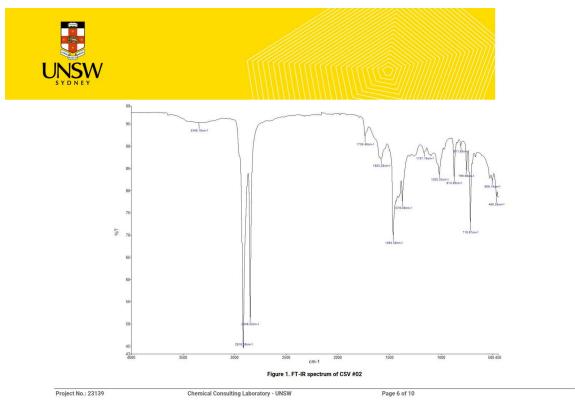

This report shall not be reproduced, except in full, without written approval of the CCL

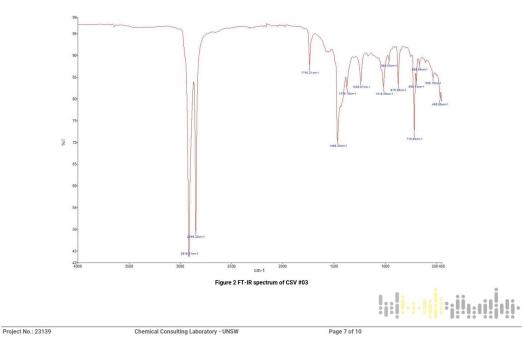


 $\textit{This report shall not be reproduced, except in full, without written approval of the \textit{CCL}}\\$


Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230111

Revision: R2.0 Page 37 of 40 Test sponsor: Cladding Safety Victoria (CSV)



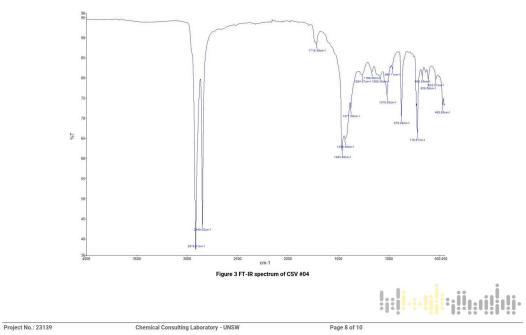


This report shall not be reproduced, except in full, without written approval of the CCL

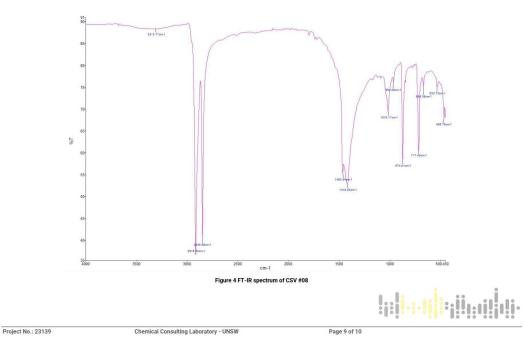

 $\textit{This report shall not be reproduced, except in full, without written approval of the \textit{CCL}}\\$



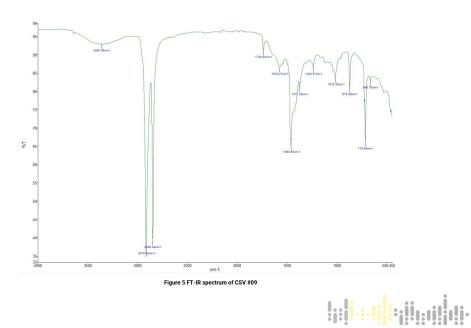

Project No.: 23139

Chemical Consulting Laboratory - UNSW

Page 10 of 10

This report shall not be reproduced, except in full, without written approval of the CCL



Global locations



Warringtonfire Australia Pty Ltd ABN 81 050 241 524

Perth

Suite 4.01, 256 Adelaide Terrace Perth WA 6000 Australia T: +61 8 9382 3844

Sydney

Suite 802, Level 8, 383 Kent Street Sydney NSW 2000 Australia T: +61 2 9211 4333

Canberra

Unit 10, 71 Leichhardt Street Kingston ACT 2604 Australia T: +61 2 6260 8488

Brisbane

Suite B, Level 6, 133 Mary Street Brisbane Qld 4000 Australia T: +61 7 3238 1700

Melbourne

Level 4, 152 Elizabeth Street Melbourne Vic 3000 Australia T: +61 3 9767 1000

Melbourne - NATA accredited laboratory

409-411 Hammond Road Dandenong South Vic 3175 Australia T: +61 3 9767 1000

General conditions of use

The data, methodologies, calculations and results documented in this report specifically relate to the tested specimen/s and must not be used for any other purpose. This report may only be reproduced in full. Extracts or abridgements must not be published without permission from Warringtonfire.

All work and services carried out by Warringtonfire are subject to, and conducted in accordance with our standard terms and conditions. These are available on request or at https://www.element.com/terms/terms-and-conditions.